

Work Order ID 124228

September-11-14 11:59:20 AM

124228 LH

Page 1

Item ID: D119-646-241

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MLS Date: 14-09-16

Tooling:

Date:

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-045	C								
IIN-D119-646	B								

100 Document Control

0.00

100

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPP D119-646-241 CHG003

N/A MLS 1503-09

110

0.00

110

Skidtubes

Memo

0.00

Skidtubes

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

DGL 14-9-19

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 124228

September-11-14 11:59:20 AM

124228

Page 2

Item ID: D119-646-241

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.00							
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00							
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00							
Quality Control									

DAS
18
9-09DAS
18
9-09

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge		
☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other		

Work Order ID 124228

September-11-14 11:59:20 AM

124228

Page 3

Item ID: D119-646-241

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

0.00

130

Skidtubes

0.00

Skidtubes

Memo

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477

4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & QSI 015.

A/RSikaflex-291

Sikaflex expire date:

Start: 14-9-22 Time: 1:20

Finish: 14-9-22 Time: 1:45

***** (Adhere for 12 hours) *****

14-9-22

14-9-22

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 124228

September-11-14 11:59:20 AM

124228

Page 4

Item ID: D119-646-241

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O 0.00


135

QC

Memo

0.00

Quality Control

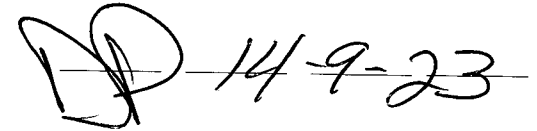DAS
03
9-23

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other _____ _____ _____
--	--	---	---

Work Order ID 124228

September-11-14 11:59:21 AM

124228

Page 5

Item ID: D119-646-241

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00

140

Skidtubes

Skidtubes

Memo

0.00

1- Bend FWD end of tube using bender 1 and bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***

2- Cut FWD end of tube as per dwg D3887.***Verify measurment***

~~8~~- Buff out marks left from bending

~~4~~- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"

~~8~~- Open FWD saddle holes to finished size as per dwg D3887

~~9~~- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)

~~8~~- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify neasurement). Open to finished size.

~~8~~- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.

~~9~~- C'sink FWD cap hole as per detail "C"

~~10~~- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.

~~11~~- Deburr and blow out chips from inside of tube.

DGC 11-9-22

14-9-26

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 124228

September-11-14 11:59:21 AM

124228

Page 6

Item ID: D119-646-241 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)
 Start Date: 9/05/14 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 9/10/14 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150 QC5- Inspect part completeness to step on W/O 0.00

150

QC Memo 0.00

Quality Control

160 0.00

160

Skidtubes Memo 0.00

Skidtubes

**DAS
18
9-09**

NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD
 GROUND HANDLING FIXTURE, IF FIXTURE FITS WELL THEN
 PROCEED.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to
 back drill each hole before welding the other side. Use aluminum rod
 A/RAluminum Rod m129285

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore x-bolt spacer holes as per Dwg D3887.

4-Deburr and blow out chips from inside of tub

> 861410-01
14-10-14
> DP 14-10-1

**DAS
18
9-09**

1 0 14-09-30

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 124228

September-11-14 11:59:21 AM

124228

Page 7

Item ID: D119-646-241

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	QC5- Inspect part completeness to step on W/O	0.00							
170			DAS						
QC	Memo	0.00	16	14/10/08					
Quality Control			9-89						
180	QC10- Inspect visual per QSI004- ground welds	0.00							
180			DAS						
QC	Memo	0.00	16	14/10/08					
Quality Control			9						
190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.00							
Hand Finishing									

14 of all 14/10/08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other _____ _____ _____
--	--	---	---

Work Order ID 124228

September-11-14 11:59:21 AM

124228

Page 8

Item ID: D119-646-241

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 9/10/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200	<i>M 124808</i>					<i>1</i>	<i>0</i>	<i>14-10-10</i>	<i>DAS 34 9-89</i>
Powdercoat	Memo	0.00							
Powder Coating	START TIME: <i>8:40</i> OVEN TEMPERATURE: <i>320</i> FINISH TIME: <i>9:10</i>								
210	QC3- Inspect Part Finish	0.00							
210									
QC	Memo	0.00							
Quality Control									<i>1211 f ell 14/10/11 DAS 15 9-89</i>
240		0.00							
240									
HandFinish	Memo	0.00							
Hand Finishing	1-Install wearplates as per Dwg D3887. 2-Inspect for foreign objects as per QSI 024 3-Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 <i>M 129459</i> Sikaflex expire date: <i>12/11</i>								<i>1211 f ell 14/10/11</i>

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other _____ _____ _____
--	--	---	---

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

September-11-14 11:59:21 AM

Page 10

Accept

Setup **Start** ***NS1***

Stop *NS2*

Start Date: 9/05/14 **Start Qty:** 1.00 *** 1 ***

Cust Item ID:

Required Date: 9/10/14 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run	Start	*NR1*
	Stop	*NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	Identification of Stock Item								

260

260

Packaging

Packaging

Identify as per dwg & Stock Location:

0.00

0.00

Memo

PPP 129039

①x

DAS
46

9-89

MAR 09 2015

270

270

QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

0.00

Memo

MLS 15-03-09

mf

15-39

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐						
Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector			
Design ☐												
Doc/Data ☐												
Equip/Tooling ☐												
Handling/Pre ☐												
Material ☐												
Operator ☐												
Offset/Setup ☐												
Process ☐												
Supplier ☐												
Training ☐												
Transport ☐												
Unapproved ☐												
FAULT CATEGORY												
Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube			General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function			☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence			☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other	

Picklist Print

September-11-14 11:59:19 AM

Page 1

Work Order ID: 124228

124228

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14

Required Date: 9/10/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
12.11.05 (DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:C 13.03.20
per chg003 ECN13-534 DD verf:JLM

IPP REVB

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured No

110

Each

125.0000

1

1

D2500-1-190

Ext'n -1' Beam Tube 4"

**

① DGL 14-9-14

Location

Loc Qty

Loc Code

LG002

125

105279

4

117806

29

120085

92

D2579

Manufactured No

140

Each

24.0000

2

2

D2579

Crossbolt Spacer

**

BEN 09-20
B129997 *2

Location

Loc Qty

Loc Code

LG001

24

113785

24

D2855-3

Manufactured No

240

Each

17.0000

2

2

D2855-3

Cap

**

ll 14/10/14

Location

Loc Qty

Loc Code

FP001

17

117601

17

XZ

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

September-11-14 11:59:19 AM

Page 2

Work Order ID: 124228

124228

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14

Required Date: 9/10/14

Start Qty: 1.00

Required Qty: 1.00

D3672-1

Manufactured No

240

Each

1,173.000

2

2

D3672-1

Washer, Phenolic

all 11/10/14

Location

Loc Qty

Loc Code

FG

10

85222

10

ST055

1163

103845

4

112218

111

113581

498

120116

500

80369

34

99099

16

VZ

D3681-1

Manufactured No

160

Each

107.0000

8

8

D3681-1

Spacer

BEH-07-30

Location

Loc Qty

Loc Code

LG

80

123088

40

123490

40

LG001

27

114884

27

B

D3849-041

Manufactured No

240

Each

0.0000

1

1

D3849-041

Fwd Wearplate Assy, Std/Float Gear

D3849-043

Manufactured No

240

Each

6.0000

1

1

D3849-043

Aft Wearplate Aay, Std Gear

B 120888 (1x) all whole

all 11/10/14

Location

Loc Qty

Loc Code

FP002

6

118842

6

11

September-11-14 11:59:20 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

September-11-14 11:59:20 AM

Page 3

Work Order ID: 124228

124228

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14

Required Date: 9/10/14

Start Qty: 1.00

Required Qty: 1.00

D3885-1

Manufactured No

140

Each

16.0000

1

1

D3885-1

Standard Web

Location

Loc Qty

Loc Code

LG002

16

119039

16

160

Each

84.0000

12

① 14-9-22 JK
861409-30

D3903-1

Manufactured No

D3903-1

Spacer

Location

Loc Qty

Loc Code

LG001

84

112408

2

117619

82

240

Each

252.0000

16

12
16

all 11/10/14

D3904-1

Manufactured No

D3904-1

Washer

Location

Loc Qty

Loc Code

ST064

252

113662

152

118903

100

240

Each

102.0000

2

2

all 11/10/14

AN3C5A

Purchased No

AN3C5A

Bolt

Location

Loc Qty

Loc Code

FG

5

122800

5

11130358

Y2

ST350

97

M128911

27

M128973

10

M129913

60

September-11-14 11:59:20 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design ☐									
Doc/Data ☐									
Equip/Tooling ☐									
Handling/Pre ☐									
Material ☐									
Operator ☐									
Offset/Setup ☐									
Process ☐									
Supplier ☐									
Training ☐									
Transport ☐									
Unapproved ☐									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge	☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--	--

Picklist Print

September-11-14 11:59:20 AM

Page 4

Work Order ID: 124228

124228

Parent Item: D119-646-241

D119-646-241

Parent Item Name: Replacement Skidtube with Run-On Wearplates (Fits LH or RH)

Start Date: 9/05/14

Required Date: 9/10/14

Start Qty: 1.00

Required Qty: 1.00

AN3C46A

Purchased

No

240

Each

201.0000

8

8

AN3C46A

Bolt

Location

Loc Qty

Loc Code

FG

10

122843

10

ST354

15

M127281

2

M128319

13

ST514

176

M128491

85

M128796

8

M129043

83

x8

MS21043-3

Purchased

No

240

Each

673.0000

8

8

MS21043-3

Nut

Location

Loc Qty

Loc Code

FG

80

103691

80

GA

496

m130186

496

x8

ST306

97

m128398

46

m129472

9

m129521

42

MS24694-C52

Purchased

No

Each

142.0000

2

MS24694-C52

SCREW

Location

Loc Qty

Loc Code

ST291

142

124308

50

m127059

92

x2

September-11-14 11:59:20 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design ☐									
Doc/Data ☐									
Equip/Tooling ☐									
Handling/Pre ☐									
Material ☐									
Operator ☐									
Offset/Setup ☐									
Process ☐									
Supplier ☐									
Training ☐									
Transport ☐									
Unapproved ☐									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

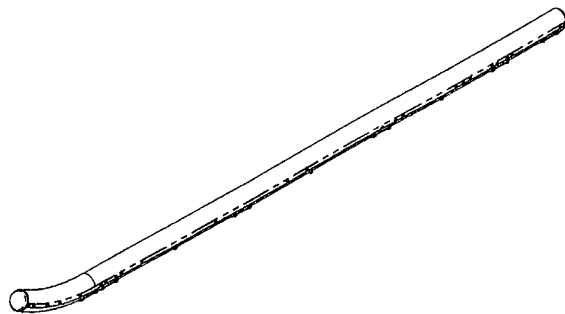

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEAPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
 POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
 BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
 D3887-043 = 37.0 lbs
 D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
 THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES
 ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT
 PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT
 PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE
 WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO ϕ 0.197 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL ϕ 0.297 HOLES FOR WEARPLATE INSERTS.
 INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS
 WITH SIKAFLEX-241/291.

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2579	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3672-1	PHENOLIC WASHER
14	8	8	8	D3681-1	SPACER
15	5			D3846-1	GASKET
16	1			D3846-11	GASKET
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		ALS4-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C46A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN960C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24694-C52	SCREW

SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT

WITHOUT NOTICE
 WORK ORDER

NO. 124228 MJS

1409-16

RELEASED
 2013-03-19

C	(SMT1, P/L, ZN C2-2, C3-2, C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3C5A, 2 PLCS. (ZN C1-5, C1-6, B4-7) ϕ 0.201 CSK ϕ 0.385 X 100" WAS ϕ 0.214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN D4-1, A8-7)	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A8-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2575 (ZN D4-1, C7-2, C2-2, C2-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C6-2, C2-2, C6-3, C2-3, C6-4, C2-4); ϕ 0.313 WAS ϕ 0.328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE N (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	AJS	DRAWING NO.	REV. C
MFG. APPR.	DS	D3887	SHEET 1 OF 8
APPROVED	JS	TITLE	SCALE
DE APPR.	JS	A119 STD SKIDTUBE ASSY	NTS
DATE	13.02.19	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS RELEASED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMBINED WITH ANY OTHER INFORMATION WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3846-11
GASKET

D3847-11
WEARPAD

1.5
1.5
1.5

2.00 DISTANCE TO D3885-1 WEB, REF

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
6 PL

D3846-1
GASKET
5 PL

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

C
MS24894-C52 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

RELEASED
2013-03-19

DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	DB		
CHECKED	<i>AJS</i>	DRAWING NO. D3887	REV. C
MFG. APPR.	<i>DS</i>		SHEET 2 OF 8
APPROVED	<i>AS</i>	TITLE A119 STD SKIDTUBE ASSY	SCALE NTS
DE APPR.	<i>AS</i>	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DATE	13.02.19		

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

RELEASED
2013-03-19

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	ALS	DRAWING NO.	REV. C
MFG. APPR.	NS	D3887	SHEET 3 OF 8
APPROVED	19	TITLE	SCALE
DE APPR.	19	A119 STD SKIDTUBE ASSY	
DATE	13.02.19	NTS	
COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

2.00 DISTANCE TO D3885-1 WEB

1.5

D3849-041
FWD TRAINING WEARPLATE ASSY

D2855-3 CAP


SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

RELEASED
2013-03-19


DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	DB		
CHECKED	AJS	DRAWING NO. D3887	REV. C
MFG. APPR.	N	SHEET 4 OF 8	
APPROVED	142	TITLE	SCALE
DE APPR.	#	A119 STD SKIDTUBE ASSY	NTS
DATE	13.02.19	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

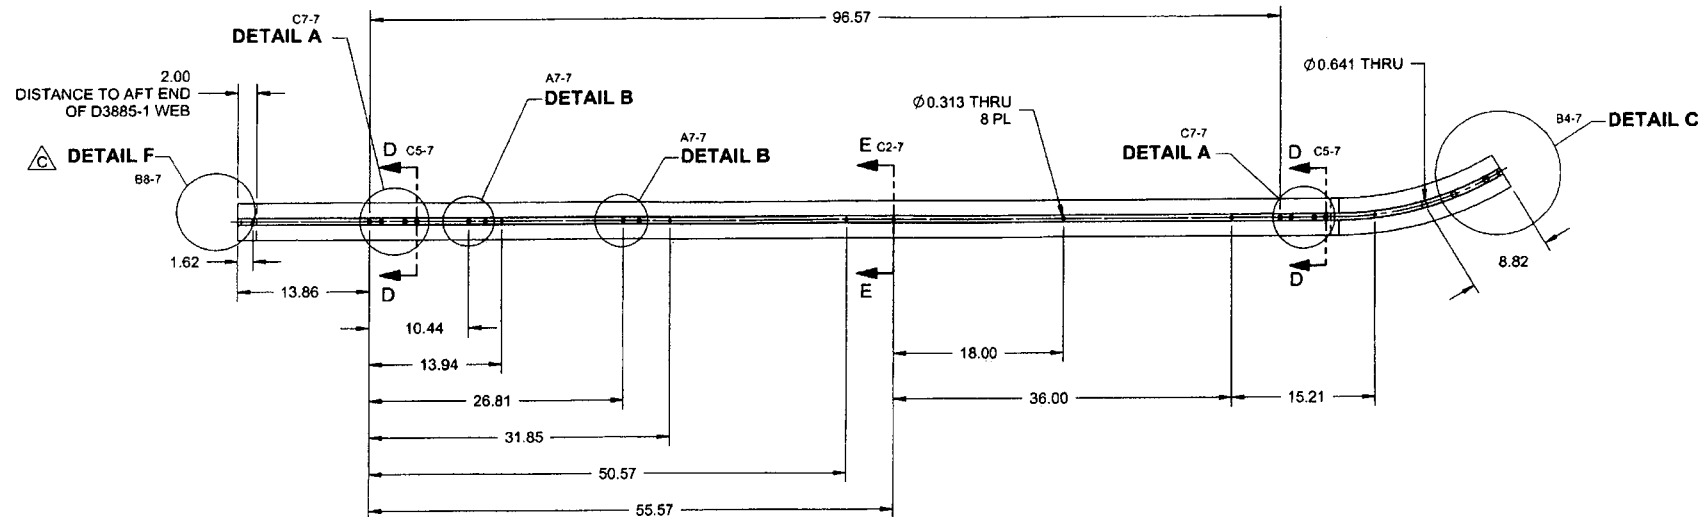

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


RELEASED
2013-03-19

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	ALS	DRAWING NO.	REV. C
MFG. APPR.	N	D3887	SHEET 6 OF 8
APPROVED	W	TITLE	SCALE
DE APPR.	W	A119 STD SKIDTUBE ASSY	NTS
DATE	13.02.19	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

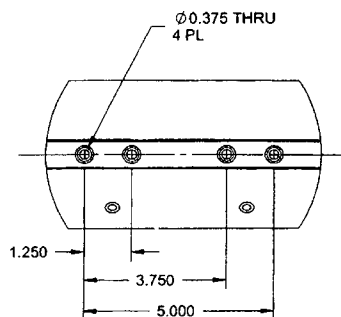


DETAIL A
SCALE 4X

D7-5
C3-5
D7-6
C3-6

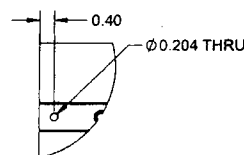


DETAIL F
SCALE 4X

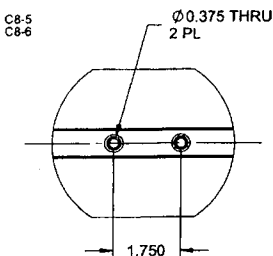


DETAIL B
SCALE 4X

C8-5
C5-5
C8-6
C5-6

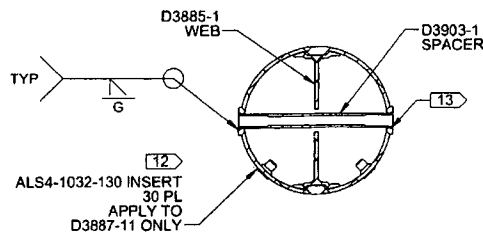


SECTION D-D
SCALE 4X

(FOR 12 X Ø 0.375 HOLES
PER SKIDTUBE)

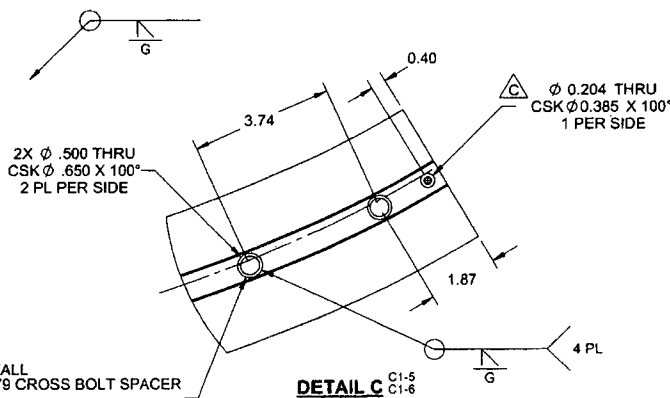

DETAIL C
TYPICAL
SCALE 4X

C1-5
C1-6

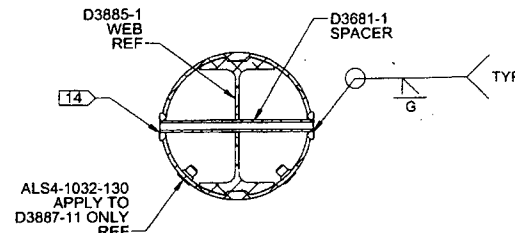

SECTION E-E
SCALE 4X

(FOR 8 X Ø 0.313 HOLES
PER SKIDTUBE)

C4-5
C4-6

NOTES:

13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø 0.375 HOLES ONLY:


- i) CHAMFER HOLES Ø 0.475 x 45°
- ii) INSERT D3903-1 SPACER
- iii) WELD INTO PLACE AND GRIND FLUSH
- iv) C'BORE TO 0.313 x 0.75 DEEP
- v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY

- PERFORM THE FOLLOWING FOR Ø 0.313 HOLES ONLY:
- vi) CHAMFER HOLES Ø 0.364 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
- vii) INSERT D3681-1 SPACER
- viii) WELD INTO PLACE AND GRIND FLUSH
- ix) DEBURR HOLES

RELEASED
2013-03-19

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	ALS	DRAWING NO. D3887	REV. C
MFG. APPR.	N	SHEET 7 OF 8	
APPROVED	W	TITLE	SCALE
DE APPR.	W	A119 STD SKIDTUBE ASSY	NTS
DATE	13.02.19	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

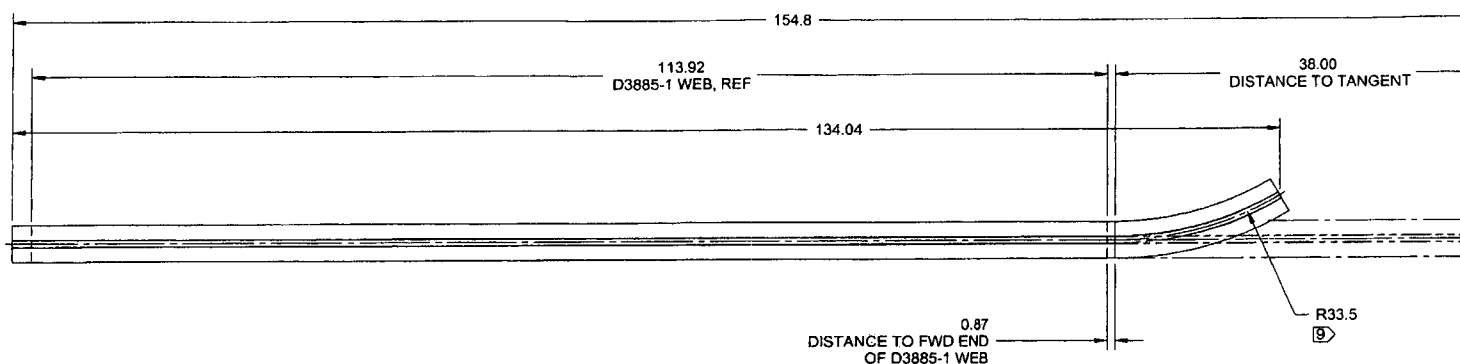

D3887-1 BEND DETAIL
(MAKE FROM D2500-1-190 EXTRUSION)

RELEASED
2013-03-19
MP

DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	DB		
CHECKED	ALS	DRAWING NO. D3887	REV. C
MFG. APPR.			SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.02.19	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	